

PASSPORT



Firmware Revision Record

5/31/2007

Model: XC-540	Version: Current 1.20	New 1.30
-------------------------	---	--------------------



PASSPORT



Firmware Revision Record

5/31/2007

Change in Spec

1. The data of the remaining media length, which is automatically saved during the setup of a cut media, is now deleted when a roll media is setup.
2. Service Report is now printed in black ink.
3. The flushing operation which is performed every 24 hours has been changed as follows.
 - After a high temperature error occurs, the machine cannot operate until recovering from the error.
 - Ø Although a high temperature error occurs, the flushing operation is performed and continued to be performed every 24 hours.
 - After a low temperature error occurs, the machine cannot operate until recovering from the error.
 - Ø Although a low temperature error occurs, the flushing operation is performed when the environmental temperature rises to the specification range and continued to be performed every 24 hours.

Following Problems have been Corrected

1. The wiper motor loses steps and the Service Call 0109 occurs.
2. Due to the individual differences of Main Board, some noise is made and the Service Call 0008 occurs.
3. On a cutting job with crop mark detection, when the job is canceled while detecting the crop marks, it only cancels the crop mark detection and the cutting is still performed.
4. Even if some correction values are set in the user menu [CROP-CUT ADJ.], they are not reflected to the actual cutting job. The correction is reflected only to the TEST PRINT pattern in [CROP-CUT ADJ.].
5. When a job is paused by the PAUSE key or an ink empty, the job cannot be resumed if the machine is left in pause for 35 min or longer.
6. When the network connection is cut off forcibly or RVW is shut down forcibly, the machine occasionally cannot receive jobs unless the main power is turned off once.
 - Ø Machine is now able to receive jobs after the sub power is once turned off instead.
7. The ink consumption excessively increases when one of the menus, Powerful Cleaning, Head Wash or Fill Ink, is performed after [FACTORY DEFAULT] in the User Menu is performed and before the sub power is turned off.



PASSPORT



Firmware Revision Record

5/31/2007

Following Problems have been Corrected

8. The amount of remaining ink displayed on the machine and RIP differs greatly from the actual amount.
9. If you enable [PERIODIC CL.] function in the user's menu, cleaning interval becomes shorter than its setting.
10. In [PRINT-CUT ADJ.]>[TEST PRINT] in the user's menu or the service menu, left edge of the pattern might not be cut.
11. If you set the temperature setting of any one of media heating system to [OFF] and then save the [PRESET] in the user's menu, the item that is set to [OFF] becomes [-100] in the system report.
12. In [TEST PATTERN]>[BI DIR.] in the service menu, test pattern is not printed out correctly.

Model:

XC-540

Version:

Current

1.10

New

1.20



PASSPORT



Firmware Revision Record

5/31/2007

Change in Spec

1. The range of the Test Pattern for Bidirectional Adjustment in Service Menu has been changed.

Following Problems have been Corrected

1. Unwanted data lines might be printed in network environments with slow transmission speeds.
2. Sometimes the Crop Marks cannot be detected.
3. The cutting pauses for 3 seconds.
4. The value for [Crop-cut adjust(F/S)] set by Service Mode cannot be printed in Service Report.
5. A part of content in the Cleaning Menu is displayed differently from the manual.

Model:

XC-540

Version:

Current

1.00

New

1.10



PASSPORT



Firmware Revision Record

5/31/2007

Initial release

Model:

XC-540

Version:

Current

New

1.00

